FACILITY CONDITION ASSES

Burger Athletic Complex | February 2022

Figure 1: System Deficiencies

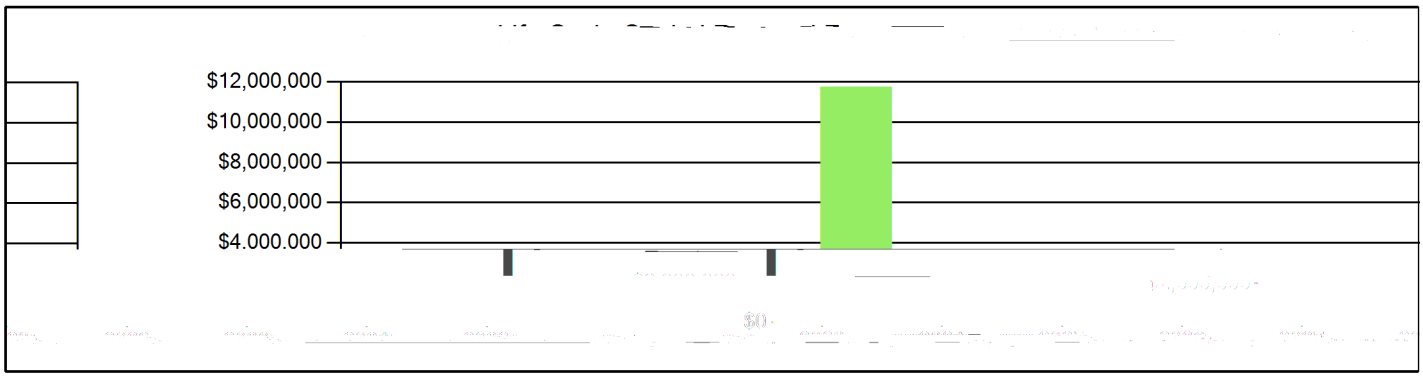
$12,000,000
$10,000,000
$8,000,000
$6,000,000
$4.000.000
$0

Structural

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Structural Study Recommended	Deferred Maintenance	1	Job	1	$6,455	6983
Note: Structural study to detail scope of work based on the 2017 crawlspace deficiencies provided by AISD						
	Sub Total for System	**1**	**items**		**$6,455**	
	Sub Total for School and Site Level	**12**	**items**		**$4,559,393**	

Building: 951A - Field House

Exterior

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Aluminum Window Replacement	Capital Renewal	48	SF	2	$4,787	1212
Note: old, single pane						
Location: ticket windows, all locations						
Metal Exterior Door Replacement	Capital Renewal	2	Door	2	$7,414	1213
Exterior Metal Door Repainting	Deferred Maintenance	41	Door	3	$4,711	1214
Note: paint faded						
Location: all doors						
Metal Panel Exterior Repair	Deferred Maintenance	60	SF Wall	3	$538	1210
Note: bent						
Location: red and blue entrance						
Exterior Cleaning	Deferred Maintenance	550	SF Wall	5	$2,130	1211

Interior

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Interior Ceiling Repainting	Deferred Maintenance	250	SF	5	$521	1217
Note: caulk and paint ceiling						
Location: restrooms						
	Sub Total for System	**1**	**items**		**$521**	
	Sub Total for Building 951B - Restrooms & Storage	**5**	**items**		**$37,054**	

Building: 951C - Concession (East)

Exterior

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Metal Exterior Door Replacement	Capital Renewal	4	Door	2	$14,828	1226
Note: aged						
Overhead Door Replacement	Capital Renewal	4	Door	2	$33,229	1227
Note: age/rot						
Wood Exterior Siding Replacement	Capital Renewal	160	SF Wall	2	$2,072	1224
Note: dry rot/fascia						
Exterior Painting (Bldg SF)	Capital Renewal	3,000	SF	4	$5,252	1225
Note: discolored						
	Sub Total for System	**4**	**items**		**$55,382**	

Interior

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Interior Ceiling Repainting	Deferred Maintenance	1,000	SF	5	$2,083	1222
Note: caulk/prep/repaint						
Interior Door Repainting	Deferred Maintenance	2	Door	5	$89	1223
Note: chipping/flaking						
	Sub Total for System	**2**	**items**		**$2,172**	
	Sub Total for Building 951C - Concession (East)	**6**	**items**		**$57,553**	

Building: 951D - Restrooms & Storage

Exterior

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Metal Exterior Door Replacement	Capital Renewal	6	Door	2	$22,242	1231
Note: age and rust						
Overhead Door Replacement	Capital Renewal	1	Door	2	$8,307	1232
Note: age						
Wood Exterior Siding Replacement	Capital Renewal	160	SF Wall	2	$2,072	1229
Note: dry rot/fascia						
Exterior Painting	Capital Renewal	3,000	SF Wall	5	$3,912	1230
	Sub Total for System	**4**	**items**		**$36,533**	

Interior

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Interior Ceiling Repainting	Deferred Maintenah9C /T6967	150	SF	5	$312	1228

Exterior

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID

Building: 951K - Pressbox (Baseball)

Exterior

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Metal Exterior Door Replacement	Capital Renewal	1	Door	2	$3,707	1280
Note: deterioration						
Wood Exterior Siding Replacement	Capital Renewal	160	SF Wall	2	$2,072	1320
Note: assessor noted that wood siding was 100% of exterior walls						
Exterior Painting	Capital Renewal	440	SF Wall	5	$574	1279
Note: age						
	Sub Total for System	3	items		$6,353	

Interior

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Vinyl Composition Tile Replacement	Capital Renewal	65	SF	4	$532	1278
Note: lifting at corners						
Interior Ceiling Repainting	Deferred Maintenance	50	SF	5	$104	1276
Note: paint drips/peeling						
Interior Wall Repainting	Deferred Maintenance	100	SF Wall	5	$225	1277
Note: water stained						
Location: bottom wall						
	Sub Total for System	3	items		$860	
	Sub Total for Building 951K - Pressbox (Baseball)	6	items		$7,213	

Building: 951L - Ticket Booth (Baseball)

Exterior

Deficiency	Category	Qty	UoM	$225

Electrical

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Lightning Protection System Installation	Functional Deficiency	31,118	SF	3	$24,301	1285
Note: not installed						
Canopy Lighting Installation	Functional Deficiency	1	Ea.	4	$1,669	1286
Note: exposed box above concessions						
	Sub Total for System	2	items		$25,970	

Specialties

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Bleacher Replacement	Capital Renewal	7,823	Seat	4	$3,231,745	1283
Note: aluminum seating/bleachero934 Tm 2 7 100.728 595.934 Tm 0 Tc 0 Tr 7 0 0 7 30.528 934 Tm (aluminum seating/S 64an64at ng/ en64of lif/ ex43 t						

Interior

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Metal Interior Door Replacement	Capital Renewal	2	Door	4	$5,788	1293
Location: level 3						
Vinyl Composition Tile Replacement	Capital Renewal	2,005	SF	4	$16,396	1292
Location: level 3 and 4						
Interior Wall Repainting	Deferred Maintenance	1,000	SF Wall	5	$2,246	1291
Note: chipping/peeling						
	Sub Total for System	6	items		$49,587	

Mechanical

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Air Handler HVAC Component Replacement	Capital Renewal	1	Ea.	2	$29,014	1307
Note: carrier AHU1 in room with cond. unit on roof. personnell complains that unit does not work; note; no access to roof to check condition of condensate units						
Ductless Split System AC Replacement	Capital Renewal	2	Ea.	2	$6,008	1306
Note: premier series heat 1000C - personell complaints that units do not work						
Ductwork Replacement (Serious)	Capital Renewal	2,000	SF	3	$15,877	1308
Note: replace all ductwork and supply diffisers due to age of installation						
	Sub Total for System	3	items		$50,887	

/Span <</MCID 64 >>BDC Q q 480.494 543.153 68 7.848 re W468.75 Tm 1 0 0 1 319.104 520.982 Tm /C0_0 1 Tf 0 Tc 0 Tw 100 Tz 0 TL 0 Ts 0 Tr 0 g 0 G 1 i 0 J 0 j 10 M 0 d [] 0 ri 0 w 0 Ts 0 Tr 0 g 0 G 1 i 0 J 0 j 10 M 0 d [] 0 ri 0 w 0 Tc 0 Tw 100 Tz 0 TL

Burger Athletic Complex - Life Cycle Summary Yrs 1-10

Site Level Life Cycle Items

Site

Uniformat Description	LC Type Description		Qty	UoM	Repair Cost	Remaining Life
Parking Lot Pavement	Asphalt		2,014	CAR	$2,921,916	5
Roadway Pavement	Asphalt Driveways		421,794	SF	$2,712,317	5
		Sub Total for System	2	items	$5,634,233	
		Sub Total for Building -	2	items	$5,634,233	

Building : 951A - Field House

Exterior

Uniformat Description	LC Type Description		Qty	UoM	Repair Cost	Remaining Life
Exterior Entrance Doors	Steel - Insulated and Painted		43	Door	$159,401	5
Exterior Utility Doors	Overhead Door		5	Door	$41,537	5
Exterior Wall Veneer	Exterior Painting - Bldg SF basis		55,380	SF	$96,956	7
Note:	listed as clean/repaint deficiency X17-04					
Exterior Wall Veneer	Metal Panel - Bldg SF basis		55,380	SF	$197,822	10
		Sub Total for System	4	items	$495,715	

Interior

Uniformat Description	LC Type Description		Qty	UoM	Repair Cost	Remaining Life
Carpeting	Carpet		3,518	SF	$44,538	2
Suspended Plaster and	Painted ceilings		14,074	SF	$29,310	3
Compartments and Cubicles	Toilet Partitions		19	Stall	$38,313	3
Wall Painting and Coating	Painting/Staining (Bldg SF)		65,443	SF	$293,245	4
Interior Swinging Doors	Wooden Door		40	Door	$75,024	4
Interior Swinging Doors	Metal Door (Steel)		5	Door	$14,469	4
Carpeting	Carpet		1,407	SF	$17,813	5
Tile Flooring	Ceramic Tile		1,407	SF	$24,858	5
Fluid-Applied Flooring	Epoxy Coating		2,111	SF	$25,445	5
Resilient Flooring	Vinyl Composition Tile Flooring		1,407	SF	$11,506	5
Interior Swinging Doors	Wooden Door		26	Door	$48,766	5
Interior Swinging Doors	Metal Door (Steel)		20	Door	$57,876	5
Interior Coiling Doors	Interior Overhead Doors		10	Ea.	$52,865	5
Interior Door Supplementary Components	Door Hardware		101	Door	$149,945	5
Tile Wall Finish	Ceramic Tile wall		2,111	SF	$17,525	7
Acoustical Suspended Ceilings	Ceilings - Acoustical Tiles		10,555	SF	$35,642	8
Acoustical Suspended Ceilings	Ceilings - Acoustical Tiles		3,518	SF	$11,879	10
Carpeting	Carpet		3,518	SF	$44,538	10
Wood Flooring	Wood Flooring - All Types		2,815	SF	$60,635	10
		Sub Total for System	19	items	$1,054,194	

Mechanical

Uniformat Description

Electrical

Uniformat Description	LC Type Description	Qty	UoM	Repair Cost	Remaining Life
Power 31 737373737373737Ts92u5TMC /1					

Plumbing

Uniformat Description	LC Type Description	Qty	UoM	Repair Cost	Remaining Life
Sanitary Sewerage Piping	Sanitary Sewer Piping	5,832	SF	$6,475	10
	Sub Total for System	8	items	$86,064	
	Sub Total for Building 951B - Restrooms & Storage	15	items	$248,179	

Building : 951C - Concession (East)

Exterior

Uniformat Description	LC Type Description	Qty	UoM	Repair Cost	Remaining Life
Exterior Wall Veneer	Exterior Painting - Bldg SF basis	4,927	SF	$8,626	2
Exterior Wall Veneer	Exterior Painting - Bldg SF basis	4,927	SF	$8,626	9
	Sub Total for System	2	items	$17,252	

Interior

Uniformat Description	LC Type Description	Qty	UoM	Repair Cost	Remaining Life
Suspended Plaster and	Painted ceilingasis				

Plumbing

Uniformat Description	LC Type Description	Qty	UoM	Repair Cost	Remaining Life
Domestic Water Piping	Domestic Water Piping System (Bldg.SF)	5,838	SF	$20,980	10
Sanitary Sewerage Piping	Sanitary Sewer Piping	5,838	SF	$6,482	10
	Sub Total for System	8	items	$94,008	
	Sub Total for Building 951D - Restrooms & Storage	15	items	$256,173	

Building : 951E - Ticket Booth (East)

Interior

Uniformat Description	LC Type Description	Qty	UoM	Repair Cost	Remaining Life
Suspended Plaster and	Painted ceilings	142	SF	$296	3
Wall Painting and Coating	Painting/Staining (Bldg SF)	142	SF	$636	7
	Sub Total for System	2	items	$932	

Electrical

Uniformat Description	LC Type Description	Qty	UoM	Repair Cost	Remaining Life
Lighting Fixtures	Canopy Mounted Fixtures (Ea.)	3	Ea.	$6,249	5
Lighting Fixtures	Light Fixtures (Bldg SF)	142	SF	$2,604	10
Power Distribution	Power Wiring				

Supporting Photos

General Site Photos

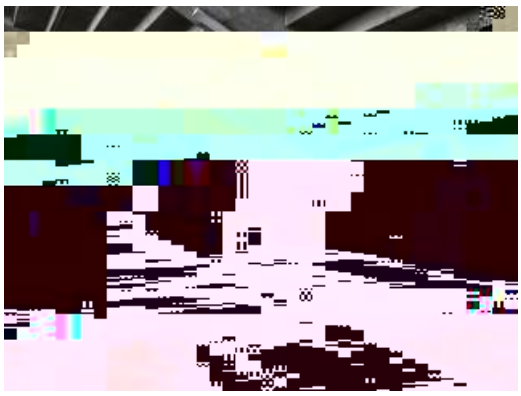

Well worn concrete slabs

Damaged wood wall panels

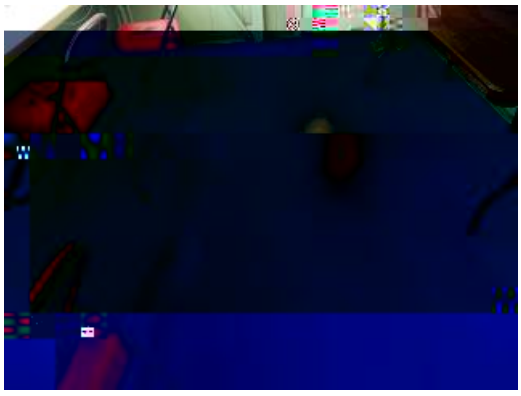

Aged vinyl composition tile flooring

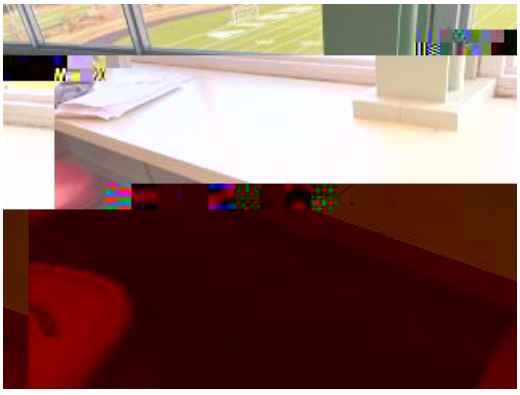

Fixed casework countertop delaminated

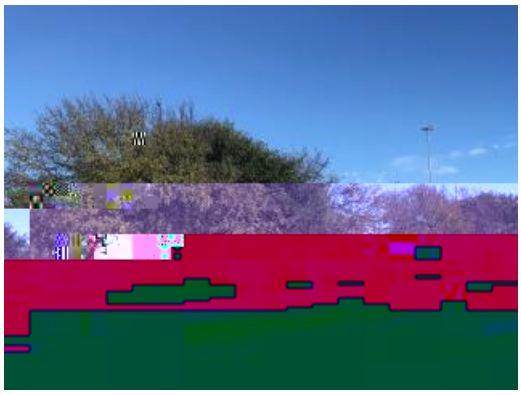

Potholes in parking lot